
User Manual - tempmote.º-51

Single-Use Temperature Logger



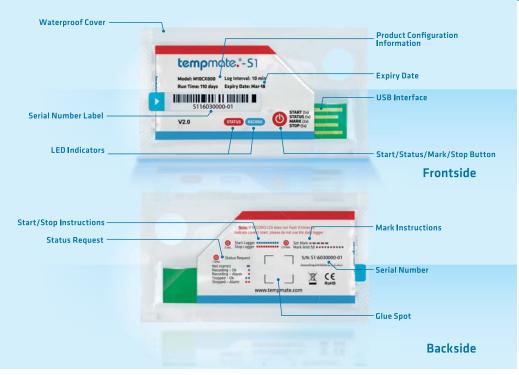

Product Overview

This document describes specific validation procedures executed for **temp**mate.®-S1 data logger, for the purpose to ensure the proper operation of **temp**mate.®-S1 data logger and provide a reliable temperature and time record during transportation and storage.

Technical Specifications

Temperature Unit	Celsius (°C)
Temperature Range	-30 °C to +70 °C
Operating Temperature	-30 °C to +70 °C
Resolution	0.1°C
Accuracy	$\pm 0.5^{\circ}\text{C}\left(-20^{\circ}\text{C to } +40^{\circ}\text{C}\right)$ $\pm 1^{\circ}\text{C}$ for other range
Runtime	Up to 160 days (depending on model)
Alarm Thresholds	Optional available
Programmable	Optional via tempbase.®-D Software (V2.0 or newer)

Report Type	Encrypted PDF file, CSV
Data Interface	USB (USB temp mate.® device)
Battery	CR2450 lithium battery
Shelf Life	2 years (Expiry Date on frontside)
Supported OS	Windows or Mac
Time Zone	UTC (UTC = GMT)
Protection Class	IP67 (waterproof)
Size	80.00 mm / 47.3 mm / 7 mm (I/w/h)
Weight	approx. 15 g
Storage Conditions	+15°C to +23°C /45% rH to 75% rH

Operation Instructions



O1 Keep button pressed for minimum 5 seconds to start recording. Then RECORD LED flashes 10 times, which indicates a successful starting. Tear off serial number label for your reference.



03 Keep button pressed for minimum 5 seconds to stop recording. Then STATUS LED flashes 10 times, which indicates a successful stopping.



O2 Press button once at any time to check current status of the logger. Double-click button to set a mark in the report. See details of these optional features in tables below.



O 4 After stopping record, tear off the transparent plastic cover and connect the logger to a USB port of the computer. The PDF ans CSV report will be generated automatically and can be found in the device's "tempmate" folder.

Operation Indication

Start / Stop

Status	Action	LED confirmation
Start Logger	5 sec pushing button	RECORD LED flashing 10 times ••••••
Set Mark	double-click button	STATUS LED + RECORD LED flashing 5 times ● ● ● ●
Stop Logger	5 sec pushing button	STATUS LED flashing 10 times ••••••

Status Request by pushing Button 1 time

Status	Action	LED confirmation
Not Started	push button 1 time	STATUS LED + RECORD LED flashing 1 time ■
Recording - OK	push button 1 time	RECORD LED flashing 1 time •
Recording – Alarm	push button 1 time	STATUS LED flashing 1 time •
Stopped – OK	push button 1 time	RECORD LED flashing 2 times ••
Stopped – Alarm	push button 1 time	STATUS LED flashing 2 times ••

© tempmate.com V5.0 V5.0 Stempmate.com